



the future is safer with altro


altro

Altro Aquarius™


Safety Flooring / Suelos de Seguridad / Sicherheitsbodenbelag

New Colours - wet & dry, any shoe & barefoot use


Altro is the first safety flooring manufacturer to recycle traditional safety flooring in-house

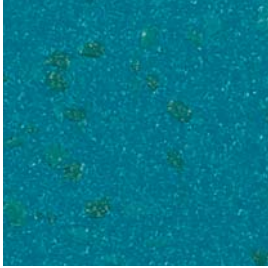


Mallard AQI2015
WR302 / A1M302 / LRV 13

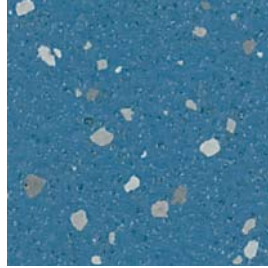


Blue Penguin AQI2002
WR288 / A1M71 / LRV 24

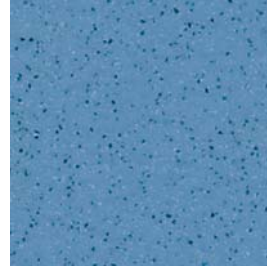


Dragonfly AQ2001
WR292 / A1M292 / LRV 33

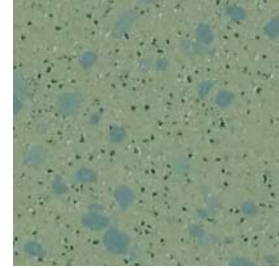


Treefrog AQI2003
WR293 / A1M271 / LRV 33

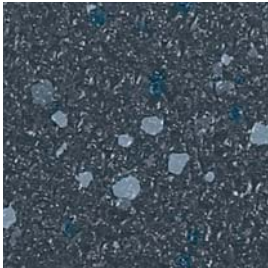


Hippo AQI2013
WR301 / A1M82 / LRV 11

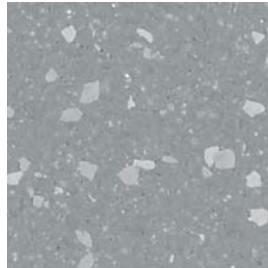


Tern AQI2008
WR261 / A1M81 / LRV 31

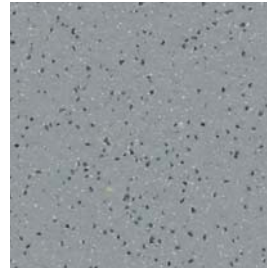


Walrus AQ2007
WR261 / A1M81 / LRV 29

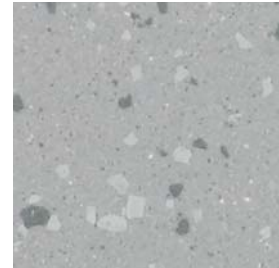


Puffin AQI2005
WR287 / A1M79 / LRV 46

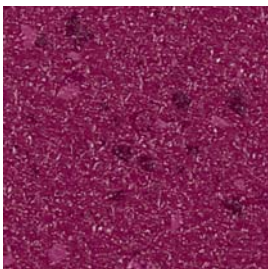


Spoonbill AQI2016
WR303 / A1M303 / LRV 11

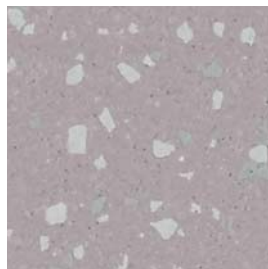


Salamander AQI2011
WR294 / A1M294 / LRV 41

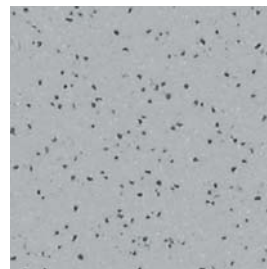

Cygnet AQ2004
WR287 / A1M79 / LRV 46

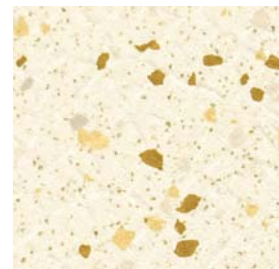


Swan AQI2012
WR291 / A1M1 / LRV 75

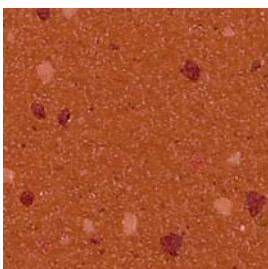


Coral Crab AQI2014
WR300 / A1M42 / LRV 14



Otter AQI2006
WR290 / A1M239 / LRV 26

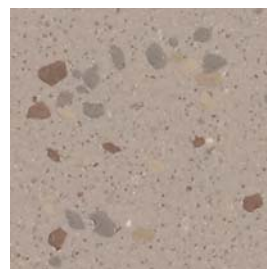

Terrapin AQI2009
WR289 / A1M265 / LRV 40

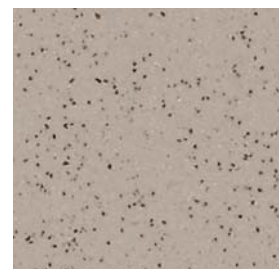

Vole AQ2010
WR289 / A1M265 / LRV 43

Light Reflectance Values measured in accordance with BS8493:2008.

Altro Whiterock™ wall cladding is the perfect complement in wet areas, for details visit www.altro.com.

Exact material match with samples cannot be guaranteed.

No podemos garantizar que el material del suelo de seguridad coincida exactamente con el de las muestras.

Eine exakte Übereinstimmung des Materials mit Mustern kann nicht garantiert werden.


















Codes: **WR** = weld rod, **A1M** = mastic, **LRV** = light reflectance value

Códigos: **WR** = Cordón de soldadura, **A1M** = Mástico, **LRV** = Valor de Reflectancia de la Luz

Abkürzungen: **WR** = Schweißschnüre, **A1M** = Altro Mastic Dichtmasse, **LRV** = Lichtreflexionswert

A+ BRE Generic Green Guide Rating for Safety Flooring, full details available at www.thegreenguide.org.uk



Flooring Type Tipo de pavimento Belagsart		EN 13845/ EN 13553	Safety flooring Suelo de seguridad antideslizante Sicherheitsbodenbelag
Classification for use Areas de uso Einsatzbereiche		EN 685	34 & 43 34 y 43 34 & 43
Slip Resistance Resistencia al deslizamiento Rutschsicherheit		TRRL EN 13845 EN 13893 DIN 51130 / DIN51097 CTE	≥ 36 Esf / ESb DS R10 / Class B Clase 3
Thickness Espesor Total Gesamtdicke		EN 428	2 mm
Flexibility Flexibilidad Flexibilität		EN 435	Pass Conforme bestanden
Wear Layer Capa de uso Nutzschicht		EN 429	2 mm
Weight Peso Flächengewicht		EN 430	2.5 kg/m ²
Roll Dimensions Dimensiones del rollos Rollenabmessungen		EN 426	2 m x 20 m = 40 m ²
Light Fastness Resistencia a la luz Lichtechtheit		EN 20105-B02	≥ 6
Sound Insulation Aislamiento acústico Trittschal		ISO 140-8	5 dB (subject to validation)
Wear Resistance Abrasión Verschleißverhalten		EN 13845	<10% particles lost over 50000 Cycles <10% de las partículas perdidas en 50.000 ciclos <10% Partikel wurden über 50000 Umdrehungen verloren
Indentation Punzonamiento Resteindruck		EN 433	≤ 0.10mm
Fire Performance Reacción al fuego Brandverhalten		EN 13501-1 EN ISO 9239-1 EN ISO 11925-2	Class Bfl s1 ≥ 8kW/m ² Pass Clase Bfl s1 ≥ 8kW/m ² Conforme Klasse Bfl-s1 ≥ 8kW/m ² , bestanden
Chemical Resistance Resistencia a los productos químicos Chemikalieneinwirkung**		EN 423	Good Buena beständig
Castor Chair Abrasion Huellas de sillas de ruedas Stuhlrollenbeanspruchung		EN 425	Pass Conforme geeignet
Under floor heating Calefacción por el suelo Fußbodenheizung		EN 12667	Suitable Apto geeignet
Electrical Behaviours Características eléctricas Elektrisches Verhalten		EN 1815	≤ 2 kV Antistatic ≤ 2 kV Antiestáticas ≤ 2 kV antistatisch

This product has never contained phthalate plasticisers. Contains bacteriostat.


** Caution Ketone/Aromatic Solvents. Please contact Altro for further technical advice regarding staining and chemical resistance. Certain chemicals may cause staining of vinyl. Traffic stain can be caused by oil residue, certain cleaning agents, asphalt and anti-oxidants in some types of rubber.

Installation and Maintenance

All Installations in accordance with Altro safety flooring instructions and Local Codes of Practice. Please refer to Altro Cleaning Card for maintenance advice. Failure to install and maintain Altro flooring in accordance with installation instructions can affect its performance and slip resistance. Floors should be protected from other trades and thoroughly cleaned before handover.

All information is correct at the time of print and is subject to change without prior notice.

Visit us at www.altro.com for more information and updates.

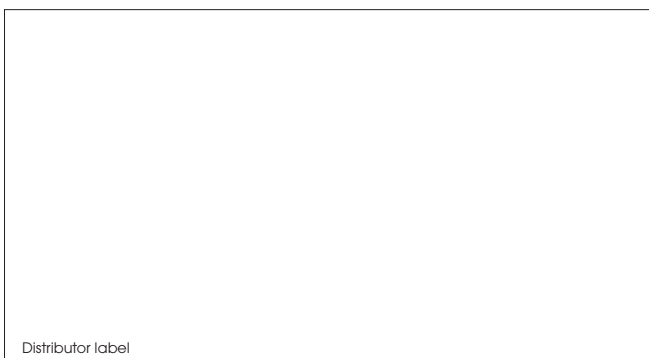

Altro Limited a company certified by SGS to ISO 9001 and ISO 14001.



For further technical information please visit www.altro.com
Si desea obtener más información técnica, visite www.altroscandess.com
Weitere technische Informationen finden Sie auf unserer Website www.altro.de

Manufactured by:
Altro Ltd, Works Road
Letchworth Garden City
SG6 1NW, United Kingdom

EN13845